

Noise Dose Meter

ST-130/ST-130S User's Manual



CE

HB2ST1300003

Contents:

1.	SAFETY PRECAUTIONS	3
1.1.	Preliminary Description	3
1.2.	Note.....	3
2.	PREPARATION FOR USE	4
2.1.	Initial.....	4
2.2.	Supply Voltage	4
2.3.	Calibration	4
2.4.	Storage.....	4
3.	INSTRUMENT INSTRUCTIONS.....	5
3.1.	Instrument Description	5
3.1.1.	Controls Description	5
3.1.2.	Display Description.....	6
3.1.3.	ST-130S Microphone	7
3.2.	Noise Does Measurement Procedures	7
3.3.	Sound Level Measurement Procedures	8
3.4.	Auto Data Record.....	9
3.5.	Single Data Record	9
3.6.	Viewing Logged Reading	9
3.7.	Set Mode	10
3.7.1.	Test Mode Set.....	10
3.7.2.	Auto Power Off Set.....	10
3.7.3.	Sampling Time & Auto Record Set.....	11
3.7.4.	Real Time Clock Set.....	11
3.7.5.	94dB Offset Adjust Set	11
3.7.6.	Noise Standard Set	12
3.7.7.	SLM Function Set.....	12
4.	SOFTWARE.....	13
4.1.	System Requirements	13
4.2.	Software Description	13
4.3.	Tools Description.....	14
4.4.	Open File.....	14
4.4.1.	Zoom Function	14
4.4.2.	Deag function	14
4.5.	Option.....	15
4.5.1.	PC Setting	15
4.5.2.	Meter Setting	15
4.5.3.	Dose Setting	15
4.6.	Print Noise Dose Report.....	16
4.7.	Sound level chart & Noise dose chart (LN %)	16
4.8.	Enable PC data logger	17
4.9.	Dowload Record data.....	17
4.10.	Erase Record data	17
5.	EXPLANATION.....	18
5.1.	1. Measurement Parameters:.....	18
5.2.	A, C, Z Weighting Instruction:.....	19
5.2.1.	Input interface.....	19
6.	MAINTENANCE	20
6.1.	General Information.....	20
6.2.	Battery Replacement	20
6.3.	Cleaning	20
6.4.	End of Life	20
7.	TECHNICAL SPECIFICATIONS.....	21
7.1.	Feature	21
7.2.	Environment	22
7.2.1.	Environmental Conditions	22

7.2.2. EMC	23
7.3. Accessories	23
8. SERVICE	24
8.1. Warranty Conditions	24
8.2. Service	24

1. SAFETY PRECAUTIONS

When taking measurements:

- Avoid doing measurements in humid or wet places - make sure that humidity is within the limits indicated in section "environmental conditions".
- Avoid doing measurements in presence of explosive gas, combustible gas, steam or excessive dust.

The following symbols are used:



Caution: refer to the user's manual. An incorrect use may damage the tester or its components



The instrument conforms to the CE standard

1.1. Preliminary Description

The ST-130/ST-130s is designed to test noise exposure in accordance with OSHA,MSHA,DOS,ACGIH, and ISO standards.

Fast and easy on-site surveys help determine noise reduction requirements.

The meter can also be used in SLM(sound level meter)mode.

The SLM mode has a datalogging feature that can record up to 1000K readings which can be download to PC for analysis.

The built-in USB interface to connect PC.

Applications: Evaluation of environmental noise, Measurements of noise at workplaces, Assessment of product noise.

1.2. Note



CAUTION

Does not observe the warning and/or operation instruction, it's possible to damage the instrument either its components or the operator

- Do not operate the instrument at temperature and humidity environment beyond to reference conditions of chapter 7.2.1.
- Keep the microphone dry and avoid severe vibration.
- Wind blowing across the microphone would bring additional extraneous noise. Once using the instrument in the presence of wind, it must mount the windscreens to prevent the undesirable signals.

2. PREPARATION FOR USE

2.1. Initial

The instrument has been checked mechanically and electrically prior to shipment. Take care to ensure the instrument reaches you undamaged.

However, it is wise to carry out a rapid check in order to detect any possible damage that may cause during transport.

If its damage, claims to the dealer immediately.

Check the packaging content according to packing list reported in 7.3.1 chapter .In case of discrepancies, contact the dealer immediately.

In the event of re-shipment of the instrument please follow the instructions reported in chapter.

2.2. Supply Voltage

The instrument is powered by batteries.

When battery voltage is low than low battery voltage, turn on low battery symbol.



CAUTION

If you don't use the instrument for a long period, please take the batteries out to prevent eventual acid leakage from damaging the instrument

2.3. Calibration

The instrument complies with the technical specifications contained in this manual and such compliance is guaranteed for 1 year. The instrument is maybe need recalibration after one year.


2.4. Storage

After a period of storage in extreme environmental conditions exceeding the limits mentioned in paragraph 7.2.1 let the instrument return to normal measuring conditions before using it.


3. INSTRUMENT INSTRUCTIONS

3.1. Instrument Description

3.1.1. Controls Description

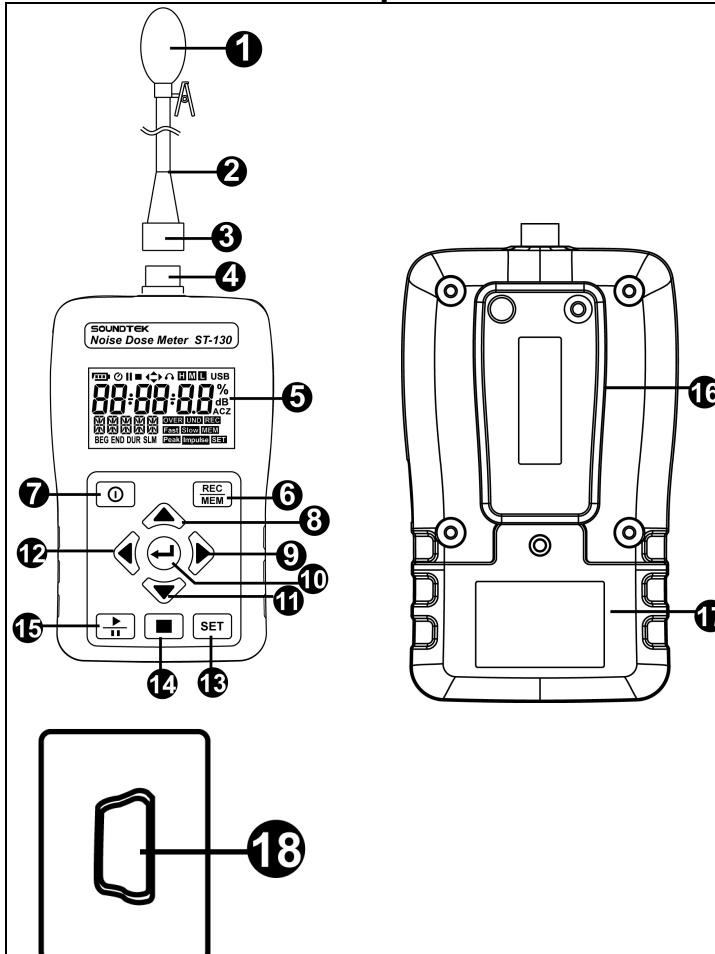	<ol style="list-style-type: none">1. Microphone2. Microphone Cable3. Microphone Connector(Male)4. Microphone Connector(Female)5. LCD Display6. Record data / Reading Record data button7. Power ON/OFF Button8. UP Button9. Right Button10. Enter Button11. Down Button12. Left Button13. SET Button14. Stop Button15. Start /Pause Button16. Belt clip17. Battery Cover18. USB Interface
--	--

3.1.2. Display Description

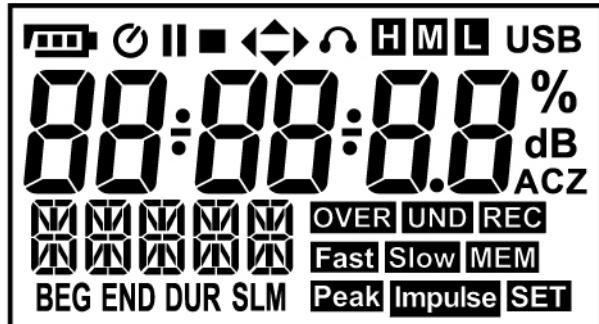


	Low Battery		Auto Power Off Enable
	Pause		115dB indicator(SPL)
	Stop	Peak	140 dB indicator(Peak)
	Start	USB	USB Interface
	SPL Hi dB Range (140~70)		dB Display
	SPL Mid dB Range (110~50)		Testing mode
	SPL Lo dB Range (90~30)	SLM	Sound Level Meter mode
	Noise Dose %	dB	Sound Noise dB
	A Weighting	Fast	Fast Weighting
	C Weighting	Slow	Slow Weighting
	Z Weighting	Impulse	Impulse Weighting
OVER	dB test data > Hi level	UND	dB test data < Lo level
REC	Solid:Auto Record standby ;Flashing Recording	BEG	Start test time
MEM	Visit record data	END	Stop test time
SET	SET mode turn on	DUR	Test duration

3.1.3. ST-130S Microphone

- Diameter : 1/2 inch
- Polarization voltage : 0V
- Dynamic range : 25dBA ~140dB
- Sensitivity : -32±3dB (250Hz 0dB=1V/Pa)
- Free field frequency response : ±2dB(25Hz~12.5kHz)

Frequency (KHz)	Deviation of pressure
0.25	0.0
1	-0.1
2	-0.5
3	-0.6
4	-0.9
5	-1.2
6	-1.7
7	-2.2
8	-2.8
9	-3.3
10	-4.1
12.5	-6.0

3.2. Noise Does Measurement Procedures

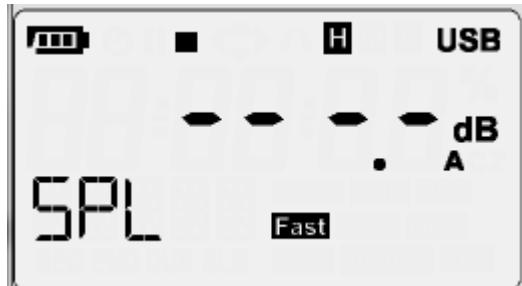

- Press turn on meter
- LCD do not display **SLM** symbol.
- Press turn on noise dose testing. , press again pause testing.
- Press select testing information
 - ◎ SPL→Dose%→LPMAX→LPMIN→PKMAX→LEQ→SEL→LEP8→TWA8→LVAG→LN%

- Press to observe testing date information. Press change date dispaly information.
- ◎ Time(hh:mm:ss)→date(YY-DD-MM)
- Press stop testing

3.3. Sound Level Measurement Procedures



- Press turn on meter
- LCD show **SLM** symbol
- Press button to select test function.
- ◎ SPL→Leq→SEL→PeakMAX
- Press testing , Press again pause testing
- If test data big than HI test range at the same time LCD showing **OVER**
- If test data small than Low test range at the same time LCD showing **UND**
- Leq integral time setting and the same sampling time
- When the sampling time is set to zero, the integration time until the user exits
- Press stop testing

CAUTION



Wind blowing across the microphone would bring additional extraneous noise. Once using the instrument in the presence of wind with speed higher than 10m/s, it must mount the windscreen to prevent the undesirable signals. Keep the microphone dry and avoid severe vibration.

3.4. Auto Data Record




- Press enabled Auto Record function.
- LCD **REC** symbol will be flash.
- The bottom left of LCD display "Write" , this mean the data will be writing to memory.
- The bottom left of LCD display "FULL", this mean the data will be full.
- Auto Record function can not use menu record.

3.5. Single Data Record

- Press each time to store the display reading and **REC** symbol flash.

3.6. Viewing Logged Reading

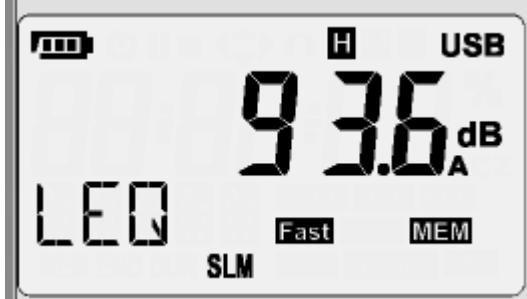

- Press button more than 1 sec into the viewing logged reading mode.
- Press or to scroll through the readings.
- Press select dose record information. (Noise Dose Meter mode)
- Press to change data or date, Press change Time.
(hh:mm:ss→YY-MM-DD)


REC
MEM

- Press **REC** or **MEM** more than 1 sec again to exit viewing logged reading mode.

3.7. Set Mode


- Press **SET** into set mode , can set 7 functions in set mode
- Press exit set mode
 - ◎ Test Mode→Auto Power Off→Sampling Time & Auto Record→Real Time Clock→94dB Offset Adjust→Noise standard→SLM Function
- Press **SET** again,save set and into next set mode

3.7.1. Test Mode Set

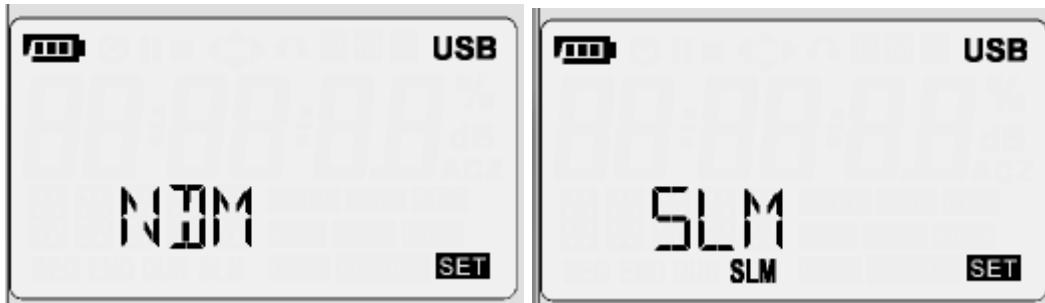


- Press or , change test mode. (NDM →SLM)
- ◎ NDM: Noise Dose Meter
- ◎ SLM:Sound Level Meter

3.7.2. Auto Power Off Set

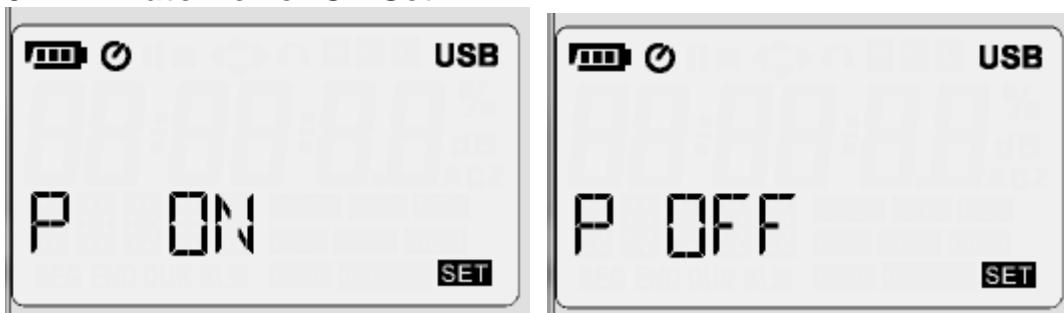


- Press or , enable or disable Auto Power Off function

3.7.3. Sampling Time & Auto Record Set

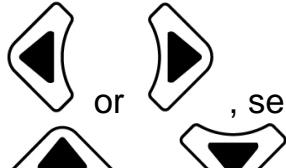

- Press or , select auto records set or sampling time.
- Press or enable or disable Auto Record, adjust sampling time.
- Minimum sampling time: 1 second; Maximum sampling time: 23 hours 59 minutes 59 seconds

3.7.4. Real Time Clock Set

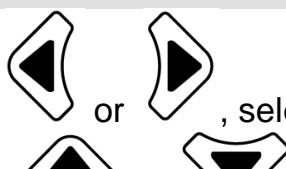

- Press or , select option to adjust.
- Press or , adjust time digit.
-

3.7.5. 94dB Offset Adjust Set



- Press , auto run 94dB offset adjust.
- Press or , change frequency weighted


- Press  or  , adjust offset

3.7.6. Noise Standard Set



- Press  or  , select NDM testing law
- ◎ OSHA→MSHS→DOD→ACGIH→ISO85→ISO90→USER

3.7.7. SLM Function Set

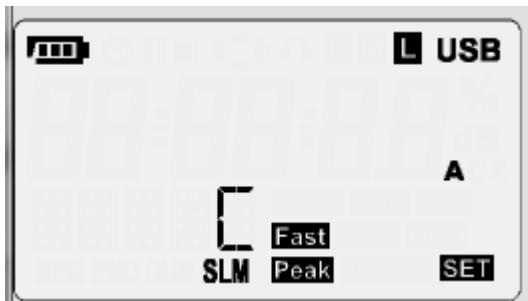


- Press  or  , change test function
- ◎ H → M → L
 ◎ Fast → Slow → Impulse
 ◎ A → C → Z
 ◎ Peak C → Peak Z
- Press  or  , select test function
- ◎ Sound level range→Time weighted→Frequency weighted→Peak frequency

4. SOFTWARE

4.1. System Requirements

- Operating: Windows XP/Windows Vista/Windows 7/Windows 8/Windows10.
- Storage:200 MB of available hard disk space.
- Processor: Intel Pentium® 4
- Memory:1 GB RAM (XP), 1.5 GB (Windows Vista/Windows 7/Windows 8)
- Other: PL2303 Windows Drive ;Microsoft .NET Framework 3.5 Service Pack 1

4.2. Software Description

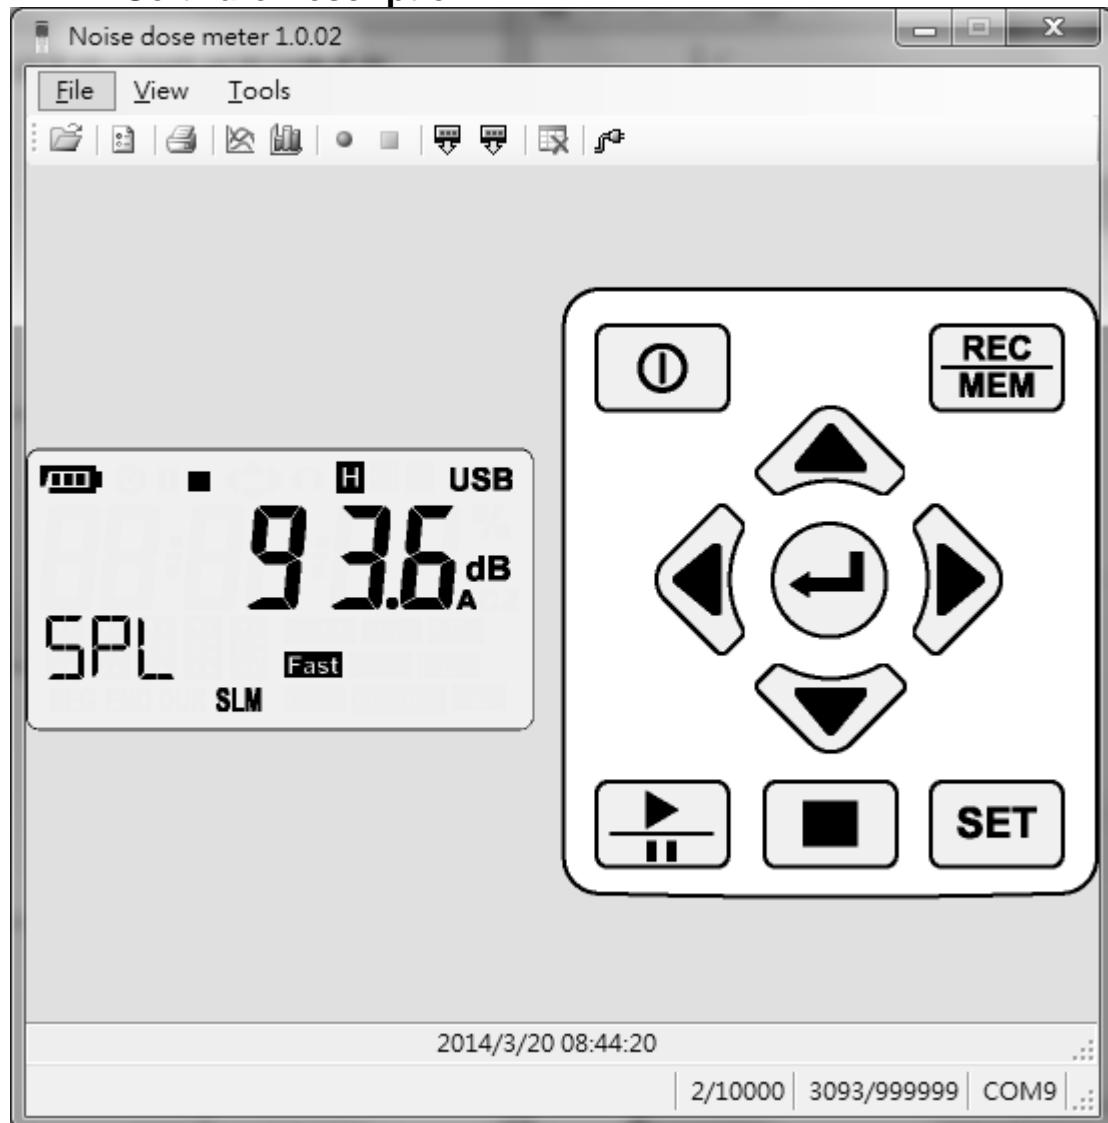

4.3. Tools Description

	Open file		Options
	Print noise dose report (*.ndr)		Sound level chart
	Noise dose chart (LN%)		Start to log sound level (*.csv)
	Stop to log sound level		Download sound level logs; Download noise does report
	Erase measured data that stored in meter		Automatic detect port which connect with meter

4.4. Open File

- Sound Level Log List Tool

Mode : <input type="button" value="SPL"/>	SPL→LEQ→SEL→PeakMax
Time Weight : <input type="button" value="Slow"/>	Fast→Slow→Impluse
Frequency Weight : <input type="button" value="A"/>	A→C→Z
<input type="button" value="LEQ & SEL"/>	Calculate LEQ & SEL
	Save file as....
	Graph

- Sound Level Logs Graph

	Zoom
	Deag
	Print
	Print Preview
	Print Setup

4.4.1. Zoom Function

- Click the left mouse button to zoom in
- Click the left mouse button to original size
- Hold the left mouse button to moving selection range
- keyboard '+', '-' can zoom in or zoom out

4.4.2. Deag function

- Hold the left mouse button can moving view range
- Hold CTRL+ left mouse button can be change view range and zoom

4.5. Option

	PC Setting
	Meter Setting

4.5.1. PC Setting

Automatic Logging 	PC data logger sample time. Click the left mouse button to change the color box Graph (Y-axis) sound level range
-----------------------	--

4.5.2. Meter Setting

User serial number : <input type="text"/>	Serial number(0~9;A~Z)16 word
Alarm 	Alarm setting
Offset 	Offset setting MAX:+1.5dB MIN:-1.5dB
Meter's date and Time 	Setting meter real time clock
<input checked="" type="checkbox"/> Auto logging Interval : <input type="text"/> 00:00:01	Enable/disable auto record. Setting sampl time
<input checked="" type="checkbox"/> Auto Play Setup name : OSHA Start time : 上午 08:56:00 <input type="radio"/> Every day <input type="radio"/> Specific date 2013年12月 6日	Enable/disable auto play noise dose function. Meter must be turn on and setting in NDM(noise does meter) mode

4.5.3. Dose Setting

Setup name : OSHA	Select noise dose standard
Run duration <input type="radio"/> Standard (8 hour) <input checked="" type="radio"/> 15 minutes	Select noise dose play time. Default standard(8hour), Other 5 ; 10 ; 15 ; 30min 1 ; 2 ; 4 ; 8 ; 10 ; 12 ; 24 hour
Import Export	Setting information import or export ,file format(*.ncg)

4.6. Print Noise Dose Report

- Select noise dose logger report (*.ndr)

Meter memory - Noise dose log list				
Item	Start time	End time	Start reason	End reason
1	2014/3/20 08:56:00	2014/3/20 09:11:00	AUTO	Normal

- Click or and key in user information , click ok ,the output report


User entered information

Company name :	<input type="text"/>
Wearer's name :	<input type="text"/>
Location :	<input type="text"/>
Department :	<input type="text"/>
Job function :	<input type="text"/>
Payroll number :	<input type="text"/>
ID number :	<input type="text"/>
User entered notes :	<input type="text"/>


OK Cancel

4.7. Sound level chart & Noise dose chart (LN %)

- Sound level char. X-axis is the time coordinate.Y-axis is the sound coordinate.
- Noise does chart. X-axis is the LN%. Y-axis is the sound coordinate.

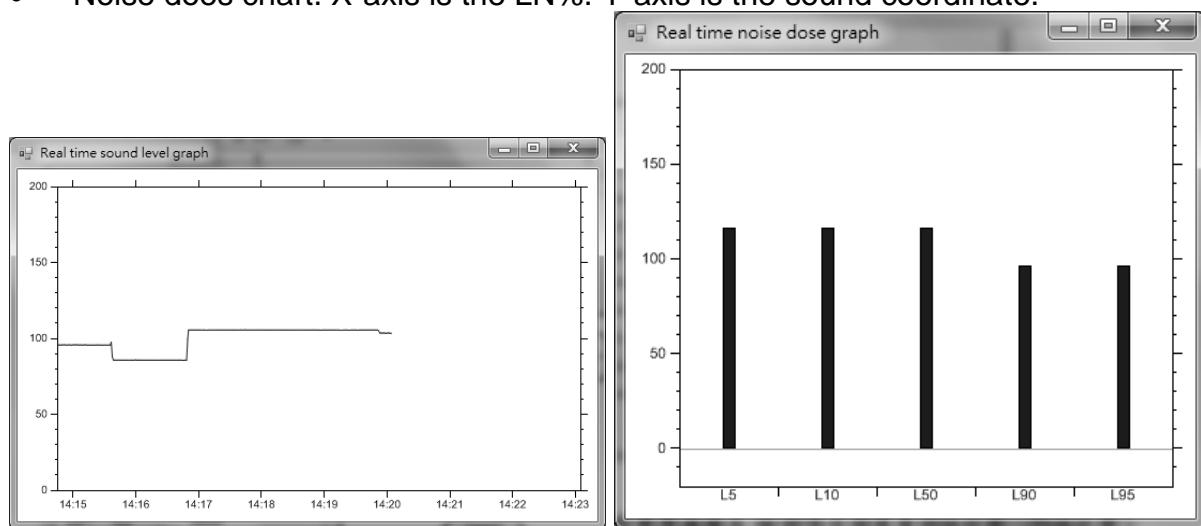

4.8. Enable PC data logger

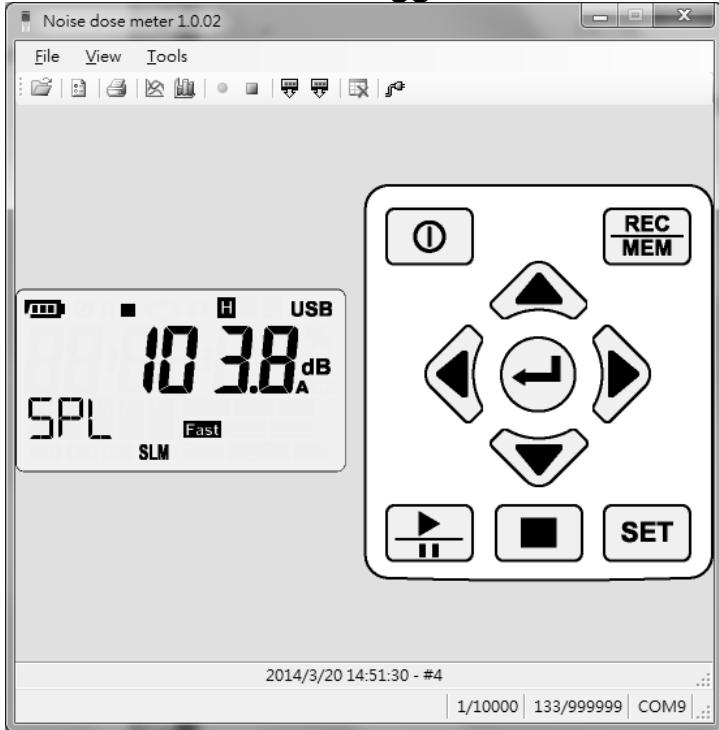

- Click enable data logger.
- Create a new log file (*. csv) in the hard disk.
- Click stop data logger.

4.9. Download Record data

- Click download sound level logs or noise dose report on the meter mrmory
- Download 100K record data. it takes about 15 minutes time-consuming, please be patiently

4.10. Erase Record data

- Click delete all records of the meter

5. EXPLANATION

5.1. 1. MEASUREMENT PARAMETERS:

Test Function	Screen parameter	Explanation
SPL	LAFp	Sound pressure level (SPL)
SPL	LASp	Sound pressure level (SPL)
SPL	LCFp	Sound pressure level (SPL)
SPL	LCSp	Sound pressure level (SPL)
SPL	LZFp	Sound pressure level (SPL)
SPL	LZSp	Sound pressure level (SPL)
Leq	LAFq	Equivalent continuous level for the duration of the measurement for A weighting
Leq	LCFq	Equivalent continuous level for the duration of the measurement for C weighting
Leq	LZFq	Equivalent continuous level for the duration of the measurement for Z weighting
SEL	LAE	Frequency weighted sound exposure level for the duration of the measurement for A weighting
SEL	LCE	Frequency weighted sound exposure level for the duration of the measurement for C weighting
SEL	LZE	Frequency weighted sound exposure level for the duration of the measurement for A weighting
Peak	Lcpeak	Instantaneous C peak level

5.2. A, C, Z WEIGHTING INSTRUCTION:

A: The A weighting curve is based on 40 Phon Fletcher-Munson Equal Loudness Contour, Noise assessment in human, suggest to use the A weighting.

C: The C weighting is essentially approximate smooth. With labor safety concern, suggest using the C weighting.

Z: The Z weighting for the electric instrument interior not the linear signal which processes after the filter, suits in wants to output AC or the DC signal does other research to use.

The Z weighting is a linear signal which is not processed through the filter.

It's suitable to output AC or DC signal for research.

Sound Level Meter Class Description:

- Class 0: use in the laboratory reference standard.
- Class 1: laboratory or field use.
- Class 2: laboratory or field use.
- Class 3: general field use.

5.2.1. Input interface


The front is PLT 4, the signal input receptacle.

ST-130

Pin 1 Power
Pin 2 GND
Pin 3 NC
Pin 4 NC

ST-130S

Pin 1 Power(+)
Pin 2 GND
Pin 3 Power(-)
Pin 4 GND

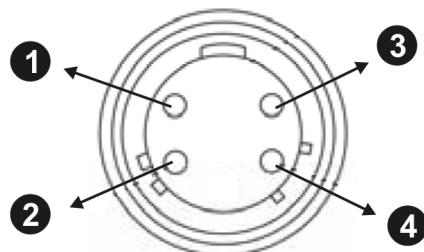

6. MAINTENANCE

6.1. GENERAL INFORMATION

This is a precision instrument. To guarantee its performances be sure to use it or keep it stored on suitable environmental conditions. Do not expose it to high temperatures or humidity or direct sunlight. Be sure to turn it off after use. If you expect not to use the instrument for a long period remove batteries to avoid leakages of battery liquid which could damage the its inner components.

6.2. BATTERY REPLACEMENT

The low battery “

- Turn off the instrument.
- Remove the battery cover.
- Remove all the batteries from the battery holder.
- Insert four new batteries of the same type respecting the polarity signs.
- Install the battery cover.
- Please depend on the local laws and regulations to process the waste battery.

6.3. CLEANING

To clean the instruments use a soft dry cloth. Never use a wet cloth, solvents or water.

6.4. END OF LIFE



Caution: this symbol indicates that equipment and its accessories shall be subject to a separate collection and correct disposal.

7. TECHNICAL SPECIFICATIONS

7.1. FEATURE

Environmental conditions: temperature 23°C ± 5°C, relative humidity < 80%.

Display	999999 count LCD
Display Refresh Rate	1 Time/sec
Standards	IEC 61252-1993 IEC 61672-1-2002 ANSI S1.25-1992 ANSI S1.4-1983 ANSI S1.43-1997
Microphone(ST-130S)	1/2" pre-polarized condenser microphone build in preamplifier: 1V/Pa@250HZ, frequency range: 20 Hz~12.5 kHz, Thermal noise: <25 dB(A)
Microphone(ST-130)	1/2 inch Electret condenser microphone
Measurement Items(NDM)	Does%,Lxyp,Lxmax,Lxmin,Lxeq,SEL(LAE),Peak,LAVG ,TWA,LEP,LN%
Measurement Items(SLM)	Lxyp,Lxeq,SEL(LAE),Peak
Measurement Range	30dB to 140dB (A) 35dB to 140dB (C) 40dB to 140dB (Z)
Dynamic Range	60 dB
Accuracy	±1.5dB@94dB 1KHZ
Internal memory	MAX Datalogger data : 10000(NDM);1000000(SLM)
Maximum Peak C Weighting Sound Level Measurement	90~143 dB
Time Weighting	Fast, Slow, Impulse, Peak
Frequency Weighting	A/C/Z
Frequency Range	20Hz~8KHz
Starting Time	< 10 Second
Battery Life(ST-130)	24 hours (9V×1 battery Alkaline)
Battery Life(ST-130S)	20 hours (9V×1 battery Alkaline)
Dimensions	113(L) x 65(W) x 34(H) mm

7.2. ENVIRONMENT

7.2.1. Environmental Conditions

- For inside use, max height: 2000m
- Reference temperature: 23° ± 5°C
- Operation temperature: 5 ~ 40 °C
- Operation humidity: <80% RH
- Storage temperature: -10 ~ 60 °C
- Storage humidity: <70%

7.2.2. EMC

EN61326-1:CISPR 11:Group 1, Class A

- Class A – Equipment for use in domestic establishments and outside facilities.
- Group 1 – RF energy generated is needed for internal functioning.

7.3. ACCESSORIES

- Meter: Noise Dose body.
- User's manual.
- Carrying case.
- 1 batteries 9 V 、NEDA 1604 、IEC 6F22 or JIS 006P
- Diameter windscreen.
- Setup CD-Disk.
- MINI USB Cable (Mini B type).

8. SERVICE

8.1. WARRANTY CONDITIONS

This instrument is guaranteed for one year against material or production defects, in accordance with our general sales conditions. During the warranty period the manufacturer reserves the right to decide either to repair or replace the product. Should you need for any reason to return back the instrument for repair or replacement take prior agreements with the local distributor from whom you bought it. Do not forget to enclose a report describing the reasons for returning (detected fault). Use only original packaging. Any damage occurred in transit due to non-original packaging will be charged anyhow to the customer.

The warranty doesn't apply to:

Accessories and batteries (not covered by warranty)

Repairs made necessary by improper use (including adaptation to particular applications not foreseen in the instructions manual) or improper combination with incompatible accessories or equipment.

Repairs made necessary by improper shipping material causing damages in transit.

Repairs made necessary by previous attempts for repair carried out by non-skilled or unauthorized personnel.

Instruments for whatever reason modified by the customer himself without explicit authorization of our Technical Dept.

The contents of this manual may not be reproduced in any form whatsoever without the manufacturer's authorization.

Our products are patented. The logotypes are registered. We reserve the right to modify characteristics and prices as part of technological developments which might require them.

8.2. SERVICE

Shouldn't the instrument work properly, before contacting your distributor make sure that batteries are correctly installed and working, check the test leads and replace them if necessary.

TENMARS ELECTRONICS CO., LTD
6F, 586, RUI GUANG ROAD, NEIHU,
TAIPEI 114, TAIWAN.
E-mail: service@tenmars.com
<http://www.tenmars.com>