

NOTES

TABLE OF CONTENTS

1.0	Design of the device	2
2.0	Calibration curves	3
3.0	Determination of the material reference moisture	3
4.0	Measuring procedure	4
5.0	Menu level overview	5
6.0	Changing batteries	6
7.0	List of calibration curves	6
8.0	Running the instrument	7
9.0	Activation of the "super user" function	8
10.0	Device maintenance instructions	8
11.0	Transfer saved data to the PC	9
12.0	Print saved data	10
13.0	Technical data	11
14.0	Exemption from liability	11
15.0	Most common reasons for miss readings	12
16.0	Warranty	13

1.0 DESIGN OF THE DEVICE

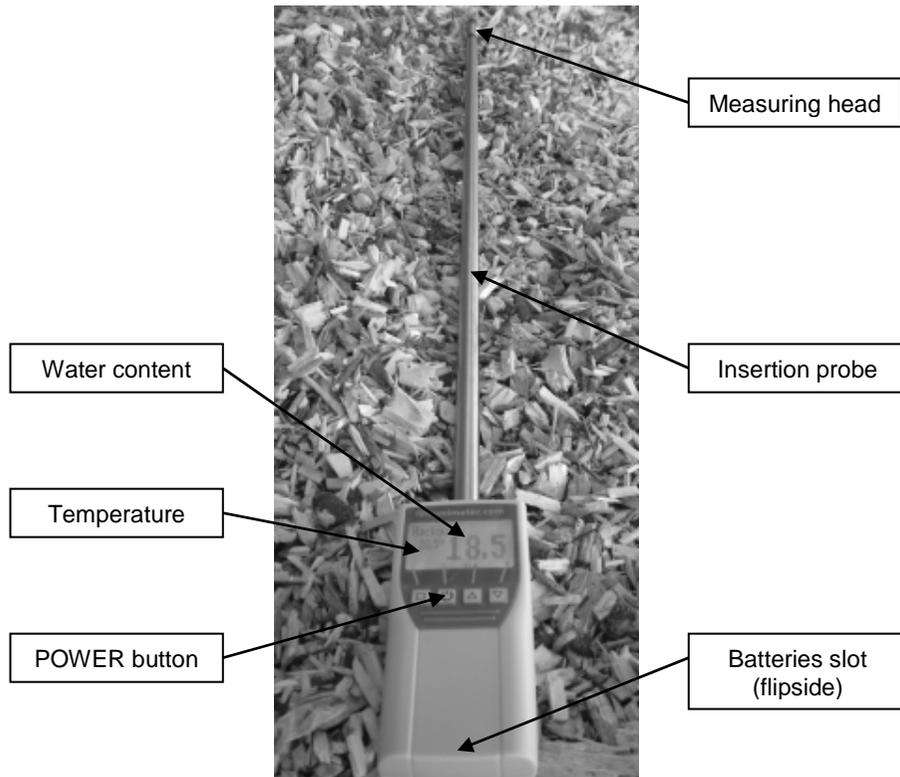

NOTES

NOTES

2.0 CALIBRATION CURVES

Calibration curves	Declaration	Measuring range
Wood chips	Standard wood chips	10 - 50%
Coarse chips	Coarse wood chips	10 - 50%
Industrial chips	Industrial wood chips	10 - 50%
Test block	<i>! Only for testing the BLL with the test block !</i>	

- **Wood chips:** standard chips of wood (forest wood chips) according to EU-norm CEN/TS 14961 class **P16** and **P45**.
- **Coarse chips:** for coarse wood chips **P45 but with fewer fines**.
- **Industrial chips:** for industrial chips of wood **without barks and fines** (similar **P63**)

Definition of wood chips classes

The stated numbers refer to the particle size that goes through round gaps of the corresponding diametres (e.g. P16: 16 mm).

- **P16** minimum 80% of the bulk is between 3,15 and 16 mm
- **P45** minimum 80% of the bulk is between 3,15 and 45 mm
- **P63** minimum 80% of the bulk is between 3,15 and 63 mm

Compression of wood chips

The BLL is calibrated for normally compressed wood chips. If the measured wood chips are compressed to a much lesser or greater extent, this will cause measuring imprecisions. Normally compressed wood chips are defined in norm CEN/TS 15103 (determination of the bulk density).

3.0 DETERMINATION OF THE MATERIAL REFERENCE MOISTURE

The principle is a comparison measurement with the dehydration method according to CEN/TS 14774. Take the measured sample and weigh it. Dry it out in an oven and weigh it again.

$$\% F = \frac{M_n - M_t}{M_n} \times 100$$

M_n : Mass with average moisture content

M_t : Mass of the dried sample

%F: Calculated moisture content

4.0 MEASURING PROCEDURE

1. For a correct measurement please ensure that the device has the same temperature than the wood chips (+/-3°C). For that reason, let your BLL adjust to the surrounding temperature of the material for at least half an hour before measuring.

2. Switch on the device: Press the  key for 3 seconds.



3. Change the calibration curve: Press one time the  key and then the  or  key. The name of the calibration curve can be seen at the head of the display.



4. Plug the probe of your BLL slowly and with caution into the wood chips to ensure reproducible results.

5. **Now the display shows the water content.** Left hand the temperature of the material is displayed.



6. To save the results in the save menu press the  ( button). The storage was successful when the number in front of the symbol  increased. To reach the store menu please press  until the  appears.



7. To name the saved results press the  button.



16.0 WARRANTY

Electromatic Equipment Co., Inc. (Electromatic) warrants to the original purchaser that this product is of merchantable quality and confirms in kind and quality with the descriptions and specifications thereof. Product failure or malfunction arising out of any defect in workmanship or material in the product existing at the time of delivery thereof which manifests itself within one year from the sale of such product, shall be remedied by repair or replacement of such product, at Electromatic's option, except where unauthorized repair, disassembly, tampering, abuse or misapplication has taken place, as determined by Electromatic. All returns for warranty or non-warranty repairs and/or replacement must be authorized by Electromatic, in advance, with all repacking and shipping expenses to the address below to be borne by the purchaser.

THE FOREGOING WARRANTY'S IN LIEU OF ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO, THE WARRANTY OF MERCHANTABILITY AND FITNESS FOR ANY PARTICULAR PURPOSE OR APPLICATION. ELECTROMATIC SHALL NOT BE RESPONSIBLE NOR LIABLE FOR ANY CONSEQUENTIAL DAMAGE, OF ANY KIND OR NATURE, RESULTING FROM THE USE OF SUPPLIED EQUIPMENT, WHETHER SUCH DAMAGE OCCURS OR IS DISCOVERED BEFORE, UPON OR AFTER REPLACEMENT OR REPAIR, AND WHETHER OR NOT SUCH DAMAGE IS CAUSED BY MANUFACTURER'S OR SUPPLIER'S NEGLIGENCE WITHIN ONE YEAR FROM INVOICE DATE.

Some State jurisdictions or States do not allow the exclusion or limitation of incidental or consequential damages, so the above limitation may not apply to you. The duration of any implied warranty, including, without limitation, fitness for any particular purpose and merchantability with respect to this product, is limited to the duration of the foregoing warranty. Some states do not allow limitations on how long an implied warranty lasts but, notwithstanding, this warranty, in the absence of such limitations, shall extend for one year from the date of invoice.

Electromatic Equipment Co., Inc.
600 Oakland Ave. Cedarhurst, NY 11516 - USA
Tel: 1-800-645-7330 / Tel: 516-295-4300 / Fax: 516-295-4399

Every precaution has been taken in the preparation of this manual. Electromatic assumes no responsibility for errors or omissions. Neither is any liability assumed for damages resulting from the use of information contained herein. Any brand or product names mentioned herein are used for identification purposes only, and are trademarks or registered trademarks of their respective holders.

15.0 MOST COMMON REASONS FOR MISS READINGS

- **Product temperature out of application range**

Material **below 0°C** resp. **above +40°C** (32 to 104 °F) may cause faulty measurements. The storage of cold material in a warm storage area usually creates condensed water which may lead to major measuring errors.

- **Not adjusted material under test**

Please ensure that the device and the material under test are being stored at the same temperature (+/-3°C) before measuring. A high temperature difference has a negative effect on the stability of the measurement results.

- **Wrong calibration curve**

Before you measure your sample, double check the correct selection of the calibration curve.

- **Wet or mouldy material**

- **Frozen measuring material**


- **Water film at the measuring head**

After measuring wet material a water film can arise on the sensor head. This could lead to a too high result in the following measurement. After measuring wet material clean both black plastic parts accurately with a dry cloth.

**ATTENTION: Risk of injury by measuring head!
Keep away from children under 16 years!**



5.0 MENU LEVEL OVERVIEW

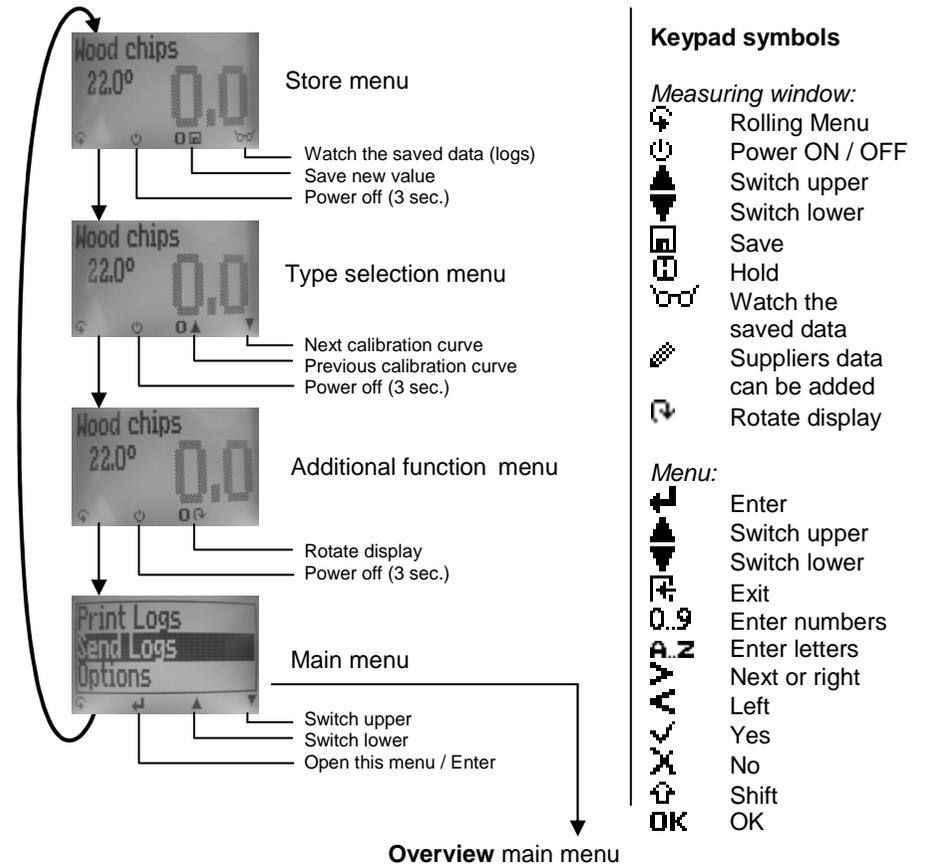


<i>Edit Logs</i>	<i>Options</i>
Manual Logs	Date / Time
Clear Logs	Log Time
<i>Print Logs</i>	Language
Last Log	Unlock
All Logs	°C / °F
Clear Logs	o Userlevel
<i>Send Logs</i>	BL On Time
Manual Logs	Auto Off Time
Clear Logs	Materialcalib.
<i>Options</i>	Password
	Reset
<i>Status</i>	

6.0 CHANGING BATTERIES

Your new device is provided with batteries.
Fitting and changing of batteries:

1. Press with your finger onto the arrow of the battery cap and pull it back.
2. Remove the empty batteries.
3. Put four new batteries in the device. Make sure that the positions of the battery poles are correct.
4. Press down the batteries and close the cap.

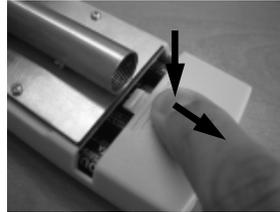

If the battery symbol appears in the measuring window resp. if a critical charge of battery is shown in the status, the batteries have to be changed IMMEDIATELY. If you do not use your moisture meter for a longer period, remove the batteries. For eventual resulting damages we cannot provide any warranty.



7.0 LIST OF CALIBRATION CURVES

Pressing the  or  key in the measuring for at least 3 seconds and a list with all available sorts will appear. Select your sort by pressing  or  and confirm it with the  key. The measurement will continue automatically.



13.0 TECHNICAL DATA

Resolution of the display	0.5% water content 0.5°C temperature
Measuring range	10 to 50% water content
Operation temperature	0°C up to +40°C
Storage temperature	-20°C to +60°C
Temperature compensation	Automatically
Power supply	4 pcs. 1.5 Volt AA Alkaline batteries (900 measurements)
Auto Switch OFF	After app. 4 minutes
Current consumption	60mA (with light)
Display	128 x 64 matrix display, lighted
Dimensions	1155 x 65 x 45 mm
Weight	830 g (including batteries)
Degree of protection	IP 40
Scope of supply	4 x 1.5Volt AA Alkaline Batteries
Option 1	Wooden case for BLL
Option 2	Test block for BLL
Option 3	USB data interface module for connection to PC
Option 4 (only with Opt. 3)	Thermo printer runs by battery


14.0 EXEMPTION FROM LIABILITY

For miss-readings and wrong measurements and of this resulting damage we refuse any liability. This is a device for quick determination of moisture. The moisture depends on multiple conditions and multiple materials. Therefore we recommend a plausibility check of the measuring results. Each device includes a serial number and the guarantee stamp. If those are broken, no claims for guarantee can be made. In case of a faulty device, please contact Electromatic (www.checkline.com).


12.0 PRINT SAVED DATA

(Only possible with USB interface module in combination with the Checkline thermo printer)

To print your saved data, connect the device to the printer using the printer cable that was delivered with your device. Carefully loose the protection cap on the BLL. At first plug in the side of the connector with the close plastic casing at the BLL. Then switch on the device.

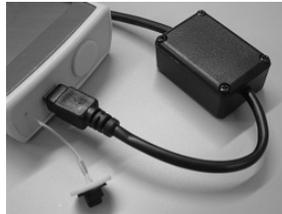

Not till then the other side of the cable has to be plugged in at the printer. Switch on the printer by pressing . Now the green LED is blinking. If it does not blink, please change the batteries and try again.

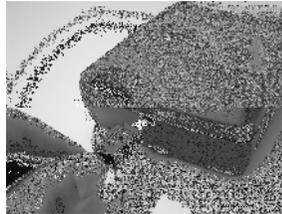


Press the button at your moisture meter until you reach the menu (see image on the right). Choose „Print Logs“ and confirm by pressing .



Now you can select if you want to print the last saved measuring series or all saved measuring series (logs).



Confirm by pressing again. The selected logs are printed out now.

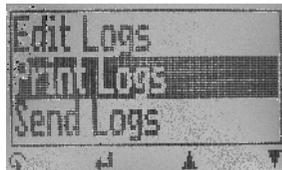

To save paper, please think of clearing the data storage regularly.

8.0 RUNNING THE INSTRUMENT

- | | |
|------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Switch on: | Press the key for 3 seconds |
| Set the clock: | Press 3 times the key -> Options -> Date/Time |
| Save measuring value: | Save the measuring value by pressing the button below the symbol. The storage was successful when the number in front of the symbol increased. To name the saved results press the button. |
| Hold measuring value: | At first activate the function in the menu Options -> Datalog time by choosing "Hold". Then press the left key until appears. Press the key. The measuring value remains on the display until another button is pressed. |
| Display lighting: | Press the key; Backlight will turn off automatically after 30 seconds. Backlight will be activated by pressing any key. |
| Power off: | Press the key for 5 seconds; the device will be switched off when you leave the key. The device also switches off automatically when no key is pressed for 4 minutes. |
| Measuring range limit: | If the measuring value is blinking, the valid measuring range is exceeded. In this case the accuracy will be decreasing. |
| Rotate display: | This function rotates the complete display. If you press the button in the additional function menu the display will rotate. |



9.0 ACTIVATION OF THE “SUPER USER” FUNCTION

2 times  - Options – Unlock

Enter the 4-digit password by using the  button (standard is the 4-digit serial number) and confirm by pressing the  button.

Changing the Userlevel

Changing from advanced user to single user:

Make sure that you have activated the “super user” functions according to the instructions above. Afterwards change to the menu and choose „Options“.

In the submenu please select „o Userlevel“ (2 times  - Options – o Userlevel)

Confirm by pressing the  button. Now the single user is activated.

Changing from single user to advanced user:

Keep both the buttons  and  pressed directly after switching on the device. Your moisture meter automatically starts the main menu. Activate the the “super user” functions according to the instructions above.

Navigate to “Options – o Userlevel” and confirm by pressing the  button.

10.0 DEVICE MAINTENANCE INSTRUCTIONS

To provide a long life of your device please does not expose it to strong mechanical loads or heat e.g. dropping it or direct sunlight exposure. Clean your device using a dry cloth. Any kind of wet cleaning damages the device.

It is not allowed to load the measuring head (stress, bending), other wise it can be broken. Plug and remove the insertion probe of your BLL straight and with caution into the wood chips.

The instrument is not rainproof. Keep it in dry areas. When the device is not used for a longer period (2 months) or when the batteries are empty, they should be removed to prevent a leakage of the battery acid.

11.0 TRANSFER SAVED DATA TO THE PC

(Only possible with the USB interface module)

To send your saved logs to the PC, connect the moisture meter device to your PC using the USB cable that was delivered with your device. Carefully loose the protection cap on your moisture meter and plug in the USB mini B connector. The bigger connector has to be connected to a USB slot on your PC. Start the LogMemorizer software on your PC and switch on your BLL.

The data transfer can be started on your moisture meter or on the software.

Starting the data transfer on the moisture meter:

Press the  key until you reach the menu (see image on the right). Then choose „Send Logs“ and confirm by pressing the  key. Now choose „Manual Logs“ and confirm with  again. All saved logs will be sent to your PC.


Starting the data transfer on your PC:

Press the button „remote control“ in the LogMemorizer software. A drop-down menu with several options opens (see image).

For transferring the data you can select „Import last manual log“ (the last saved measuring series is transferred) or „Import all manual logs“ (all saved logs are transferred).

If you click on one of these menu items, the transfer starts immediately.

For the basic adjustments of the software please look through the instructions on the LogMemorizer CD.

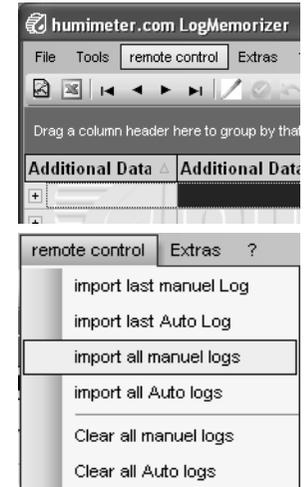

BLL & BLL-USB

WOOD CHIP MOISTURE METER



ELECTROMATIC
EQUIPMENT CO., INC.

600 Oakland Ave., Cedarhurst, NY 11516-U.S.A.
TEL: 516-295-4300 • FAX: 516-295-4399